

Sensigas[®] Gas detectors Carbon dioxide (CO₂) ATEX II 2G Ex d IIC T6 Gb certified

URD40SE



11...14Vdc power supply.

Not Dispersive Infrared (NDIR) sensor designed for the detection of carbon dioxide (CO_2) .

Up to three alarm thresholds plus sensing element fail.

LED on sensing element body to indicate operating status.

Automatic countdown of sensor life.

Use

The URD40SE detectors are used to detect the presence of carbon dioxide (CO₂), in areas classified as Zone 1.

It detects carbon dioxide leaks or emissions in industrial environments, hospitals, fermentation plants, greenhouses, stables and, more in general, where carbon dioxide is stored, generated or produced.

URD40SE detectors transmit data from a local bus connected with their Control Unit, which acts as the master unit of the gas detection system.

Operation

If there is a gas leakage, the detector compares the measured concentration value with the threshold limit setpoints and energises the system relays if associate.

Alarm information is transmitted to the Control Unit, which energises its own internal relay module (MR0) and the remote Relay and Display modules depending on the associations.

Ordering

To order, simply state the part number: **URD40SE**.

For special versions, on request, please contact Customer Service.

EsiWelma® srl	EW0526D1_en - rev. A	CO ₂ gas detectors – URD40SE
05/10/2020	Gas detection systems for industrial environments	1/4

Technical characteristics

NDIR (Non Dispersive Infrared) Type of sensor

Detectable Gas Carbon dioxide (CO₂)

Power supply 11÷14Vdc Max power consumption 1,6W

Precision \pm 5% full scale, \pm 10% readout Repeatability \pm 5% full scale, \pm 10% readout

0...20.000 ppm

255 weeks

Measurement resolution 20 ppm

Microprocessor resolution 1024 points (10 bit) Digital filter system Kalman Filter Watchdog Internal Warm-up time < 2m Stabilization time < 2m Response time < 25s (T90)

Average Sensor life (in air) Threshold limit settings

(default setting):

Measuring range

Pre-alarm 2000 ppm 1st threshold alarm 4000 ppm 2nd threshold alarm 8000 ppm

Operating Temperature -20 ÷ 50 °C Storage Temperature -20 ÷ 70 °C

Relative Humidity (without condensing)

15 ÷ 90 %RH Operation 45 ÷ 75 %RH Storage Operating pressure (KPa) 80 ÷ 110

Air speed (m/s) ≤ 6

Visual warnings Red LED visible with detector energized The steady LED status can be forced by the Control Unit to identify the sensor on

the plant

See dedicated section Dimensions and weight

Options & Accessories

ATEX markings

TUL40.. Gas calibration kit TUS40 Handheld terminal for service and maintenance CRG40 Gas collecting cone PAP40 Powerful jets protection

See dedicated data sheet

See dedicated data sheet

(ξ_{1370} $\langle \xi_{x} \rangle_{\text{II 2G}}$ Ex d IIC T6 Gb

BVI 07 ATEX 0032 + Ext 02/14

See installation and commissioning chapter

See installation and commissioning chapter

-20°C $\leq T_A \leq +50$ °C

Key to marking information

Marking in conformity with all applicable EC Directives

Identification number of Notified Body involved in production control

1370 (ϵ_x)

CE marking for all equipment in conformity with Directive ATEX 2014/34/EC

Ш Equipment group for surface industry 2 Equipment category 2 for use in Zone 1

G Equipment intended for use in explosive gas atmosphere, caused by mixture of air and gas, vapours, flammable mist

Ex d IIC T6 Gb Type of protection complying with EN60079-0 and EN60079-1 BVI 07 ATEX 0032 + Ext 02/14 EC-type examination certificate

-20°C ≤ TA ≤ +50°C Operating temperature range

Sensors lifetime

Sensor average lifetime (see technical characteristics) is referred to a typical usage in a pollution-free environment. Presence of a high concentration of pollutants can shorten the lifetime of the sensing element.

Once the detection system starts up, it has to be supplied with energy during all the lifetime of its sensors. Seasonal use of the detection system is not recommended.

EsiWelma® srl	EW0526D1_en - rev. A	CO ₂ gas detectors - URD40SE
05/10/2020	Gas detection systems for industrial environments	2/4

Installation

The relative density of carbon dioxide is about one and a half times that of air, so it tends to collect at floor level in closed, unventilated environments.

Therefore, the sensor must be installed about 30 cm above the floor level.

Take into consideration the following specific installation guidelines, as well as the above instructions, for location of the detectors.

The detectors must be installed:

- 1. where accidental gas leakages are possible
- 2. at least 1.5m away from heat sources or from vent holes
- 3. not in spaces where ventilation is poor and where gas pockets may form
- 4. away from hindrances to natural gas flow
- 5. away from equipment that may leak gas during normal operations
- 6. in environments with a temperature range of -20°C to 50°C and relative humidity below 90% (non-condensing)
- 7. Disconnect equipment from the power supply when mounting and dismantling detectors.

Special recommendations

CAUTION: safety is guaranteed only if cover is screwed on tight.

- Tighten the cover clockwise, and when it is screwed on, make sure that there is no more than 0.5 mm between housing and cover. This guarantees that it is screwed on tight. Remember to tighten the hexagon locking grub screw that fits into the end of the cover
- Ensure compliance with the words << DO NOT OPEN WHEN ENERGISED >>, clearly indicated on the cover. Alternatively, make the area safe before opening the sensor cover.

Electrical installation and configuration

<u>CAUTION:</u> Make the area safe and ensure that the device power supply is off before cabling and configuration operations.


Install the sensor in compliance with EN 60079-14.


ATEX certified 1" NPT cable glands are used for cable entry, in compliance with standards EN 60079-0 and EN 60079-1 (Ex d protection mode).

Ground the sensor using the internal grounding system.

Refer to the Control Unit manual for all cabling information (cable type and specifications, bus topology, length of connections etc.) and configuration.

Terminal board and electrical connections

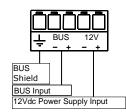

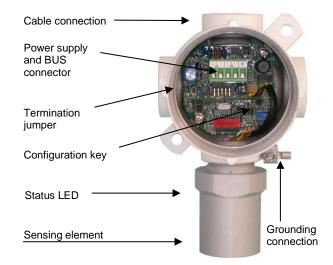

Cabling:

Depending on the connecting distance, use at least 4-core cable, min. diameter 0.75mm² up to 100m, 1mm² up to 200m, 1.5mm² up to 500m.

Use shielded cable where there is a risk of electromagnetic interference.

EsiWelma® srl	EW0526D1_en - rev. A	CO ₂ gas detectors – URD40SE
05/10/2020	Gas detection systems for industrial environments	3/4

Checklist after mechanical and electrical installation

Before using the sensor it must be recognised by the Control Unit through an assignment operation (refer to the manual of the aforesaid Control Unit for correct execution).

The sensors are factory calibrated so they normally do not require any other calibration once installed. Still, after installation, an operational check of the sensors is recommended.

The status LED means the following:

Flashing at 2Hz

Flashing about every 10 sec

Steady

NOT ASSIGNED

ASSIGNED AND WORKING

ALARM

Maintenance

A sensor functional test should be carried out every three-six months.

Routine

Routine maintenance involves repeating the same tests as set forth in "checklist after mechanical and electrical installation".

Corrective

If any abnormalities are found during routine sensor maintenance, return the sensor concerned to the supplier / installer, who in turn will send it back to the manufacturer.

Sensors may need to be re-calibrated, using the **TUL40..** gas calibration kit and the **TUS40-40** handheld terminal, which must be connected to the sensor via the communication on the Power supply and BUS connector.

For the re-calibration procedure, see the instructions supplied with the handheld terminal

Decommissioning

Remove power from the detector, disconnect all wiring and conduits and dismount the housing from all the blocking systems.

Warranty

Warranty on EsiWelma products is valid for 12 months from installation date and no longer than 24 months from manufacturing date on the product. Installation data, stamp and signature on the data sheet filled in by the installer will be considered proof for warranty.


A copy of the warranty data sheet must be sent when returning the product under warranty.


Accessories

TUL40.. Gas calibration Kit TUS40 Handheld terminal CRG40 Gas collecting cone PAP40 Powerful jets protection

Dimensions and weight

Dimensions (HxWxD): 164x100x82mm.

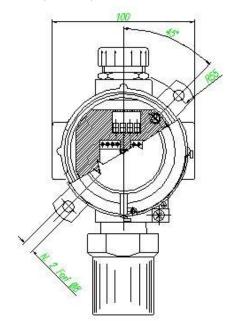

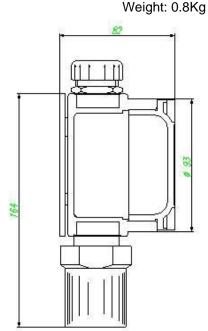

Due to our policy of continuous product improvement, specifications are subject to change without notice.

EsiWelma® srl	EW0526D1_en - rev. A	CO ₂ gas detectors – URD40SE
05/10/2020	Gas detection systems for industrial environments	4/4